The run chart: a simple analytical tool for learning from variation in healthcare processes

Rocco J Perla,¹ Lloyd P Provost,² Sandy K Murray³

► An additional text box is published online only. To view this file please visit the journal online (http:// qualitysafety.bmj.com).

¹UMass Memorial Health Care, Worcester, Massachusetts, USA ²Associates in Process Improvement, Austin, Texas, USA ³Corporate Transformation Concepts, Eugene, Oregon, USA

Correspondence to

Dr Rocco J Perla, Office of Quality and Patient Safety, Center for Innovation and Transformational Change, 22 Shattuck Street, Worcester, MA 01605, USA; rocco. perla2@umassmemorial.org

Accepted 26 July 2010

Background: Those working in healthcare today are challenged more than ever before to quickly and efficiently learn from data to improve their services and delivery of care. There is broad agreement that healthcare professionals working on the front lines benefit greatly from the visual display of data presented in time order.

Aim: To describe the run chart—an analytical tool commonly used by professionals in quality improvement but underutilised in healthcare. Methods: A standard approach to the construction, use and interpretation of run charts for healthcare applications is developed based on the statistical process control literature.

Discussion: Run charts allow us to understand objectively if the changes we make to a process or system over time lead to improvements and do so with minimal mathematical complexity. This method of analyzing and reporting data is of greater value to improvement projects and teams than traditional aggregate summary statistics that ignore time order. Because of its utility and simplicity, the run chart has wide potential application in healthcare for practitioners and decision-makers. Run charts also provide the foundation for more sophisticated methods of analysis and learning such as Shewhart (control) charts and planned experimentation.

The skills associated with using data for improvement vary widely among those working to improve healthcare. We describe a simple analytical tool commonly used by professionals in quality improvement, but underutilised in healthcare—the run chart.¹ For those health professionals that use run charts, they provide a valuable source of information and learning for both practitioner and patient. The following scenario described by Neuhauser and Diaz² provides one example of the simplicity of run charts and their potential for wide application in healthcare: Susan Cotey is a diabetes educator at Huron Hospital in Cleveland, Ohio. She gives out graph paper to elderly diabetic patients who live in the most impoverished part of her city. She uses a self-help book designed specifically for her patients. Each patient gets a copy. She asks them to plot their blood sugar measures over time, connect the dots and bring their graphs in to small discussion groups of similar patients who share their experience and learn about diabetes selfmanagement (diet, exercise, weight control). Nearly every patient brings in their graph. The large majority of patients improve their diabetic control. This hospital has made diabetes management a centre of its healthcare mission.

The use of run charts by these patients with diabetes summarises the spirit of our paper—the run chart has a role to play in healthcare improvement work.

Although many healthcare professionals now recognise the value of statistical process control methods, applications and tools in improving the quality of care, much of this focus in the healthcare improvement literature is on Shewhart (control) charts and their various derivatives (such as cumulative summation charts and funnel plots).³ Very little has been written about the use and application of run charts.

The run chart allows us to learn a great deal about the performance of our process with minimal mathematical complexity. Specifically, it provides a simple method to determine if a process is demonstrating non-random patterns, what we term a 'signal'. By focussing on the time order that data are collected, the run chart can be applied when traditional methods to determine statistical significance (t-test, chi-square, F test) are not useful. Important uses of the run chart for improvement activities include the following⁴:

- Displaying data to make process performance visible
- Determining if changes tested resulted in improvement
- Determining if we are holding the gains made by our improvement
- Allowing for a temporal (analytic) view of data versus a static (enumerative) view

Displaying data on a run chart is often the first step in developing more complex Shewhart (control) charts^{4 5} and in the design of planned experiments.^{6 7} In this paper, we briefly outline the construction, interpretation and use of run charts.

DEFINITION AND CONSTRUCTION OF A RUN CHART

A run chart is a graphical display of data plotted in some type of order. The horizontal axis is most often a time scale (eg, days, weeks, months, quarters) but could also include sequential patients, visits or procedures. The vertical axis represents the quality indicator being studied (eg, infection rate, number of patient falls, readmission rate). Usually, the median is calculated and used as the chart's centreline. The median is required when using the probability-based rules to interpret a run chart (see below). The median is used as the centerline because (1) it provides the point at which half the observations are expected to be above and below the centerline and (2) the median is not influenced by extreme values in the data. Goal lines and annotations of changes and other events can also be added to the run chart. Figure 1 shows an example of a run chart. As shown in figure 1, the run chart helps us understand and visualise the impact of different interventions and tests of change over time. To determine objectively when these data signal a process improvement, we use the median and run chart rules described in the next section.

The primary advantage of using a run chart is that it preserves the time order of the data, unlike statistical tests of significance that generally compare two or more

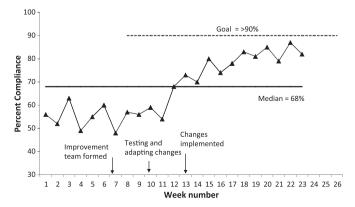


Figure 1 Example of a run chart demonstrating compliance with a standard procedure.

aggregated sets of data. For example, the summary statistic presented in figure 2 looks like there is improvement in the before to after data attributed to a change in the system. Summary statistics for each of the three units shown in figure 2 where the change was tested produce the same pre-test mean and SD (70 min, 11.3 min) and post-test mean and SD (30 min, 13.15 min). Further, a t-test produced a highly significant result ($t_{22}=7.88$, p < 0.001). The question we want answered, however, is not whether our change was statistically significant but whether the change is associated with a sustainable improvement in each unit where the change was tested. Data from Unit 1 would yield the bar chart in figure 2 and support the conclusion that we have achieved a sustainable improvement. Data from Unit 2 would yield the same bar chart but the data here reveal that improvement was already occurring before the change was tested. Data from Unit 3 would also result in the same bar chart. In Unit 3, the change did result in improvement, however, it was not sustained. Viewing data over time rather than in summary statistics yields richer data and more accurate conclusions for improvement projects.

RULES TO HELP INTERPRET A RUN CHART


When improvement data are presented in healthcare (eg, clinical reports, dashboards, project updates, and board reports), people will often over- or under-react to a single or most recent data point (and begin tampering, possibly making things worse).⁸ The terms 'shift' and 'trend' are often used indiscriminately on a subjective basis as a means for moving a conversation or decision forward, without recognition that statistical definitions of such terms exist and rely on more than a single data point. The three probability-based rules below are used to objectively analyse a run chart for evidence of nonrandom patterns in the data based on an α error of p < 0.05. Although there is nothing magical about the 0.05 level of significance, it provides an objective statistical threshold for whether changes are leading to improvement or degradation in a process and is consistent with typical practice in research. The threshold could be made more or less stringent based on the particular situation, but an agreed upon approach is critical to establish especially if many people are looking at, and acting on, the data being presented. The rules below are appropriate for quality improvement projects (where improvement is planned and expected) and have been shown to be effective in detecting signals in a wide range of healthcare applications.^{9 10}

Rule 1—shift

Six or more consecutive points *either* all above or all below the median. Values that fall on the median do not

ORIGINAL RESEARCH

Figure 2 Summary statistics versus time-ordered data. (Each unit has the same 24 data values ordered differently over time.)

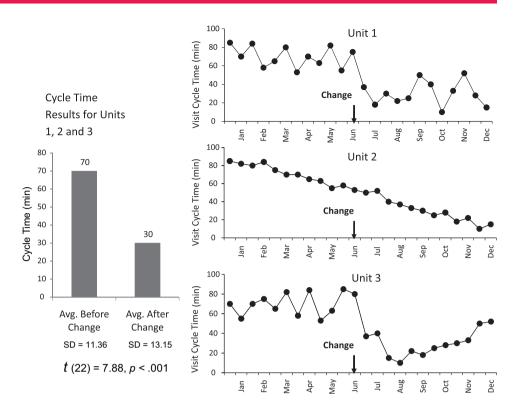

add to nor break a shift. Skip all values that fall on the median and continue counting.

Rule 2-trend

Five or more consecutive points all going up or all going down.¹¹ If the value of two or more consecutive points is the same, only count the first point and ignore the repeating values; like values do not make or break a trend.

Rule 3—runs

A non-random pattern is signalled by too few or too many runs, or crossings of the median line.¹² A run is a series of points in a row on one side of the median. If only chance is influencing the process being measured with a run chart, then there should be a regularity at which data points go above and below the median to satisfy this condition. Some points can fall exactly on the median line, which makes it hard to decide which run these points belong to. An easy way to determine the number of runs is to count the number of times the line connecting the data points crosses the median and add one. Tabled critical values are used to determine if too many or too few runs exist (see table 1). Figure 3 shows an example of a run chart with too few runs, where it is possible that an intervention is keeping the data from dipping back down below the median which is where it would tend to go if the data were random.

Rule 4—astronomical point

Used in detecting unusually large or small numbers. An astronomical data point is one that is obviously, even

blatantly, different from the rest of the points; all studying the chart would agree the point is unusual. Astronomical points should not be confused with the highest or lowest data points, which every run chart will have. While Rules 1, 2 and 3 are probability based, Rule 4 is subjective and recognises the importance of the visual display of the data in a run chart.

Figure 3 shows the four rules for identifying nonrandom signals with actual run charts. Of course these rules, like any others, can only be understood in the context in which they are being applied. Nevertheless, having simple and consistent guidelines to distinguish between random variation and non-random signals is an important part of learning from data.

Good technique in using a run chart to learn about the impact of changes is to create an initial median using baseline data. If the baseline data come from a process exhibiting no signals (shift, trend, runs, astronomical data point), extend or 'freeze' this initial median into the future.⁴ By using the baseline data and extending the median into the future, new data are not allowed to influence the initial median. Any changes in the new data stand out against the baseline median more clearly allowing for more accurate detection of signals of improvement (the probability-based rules are relative to this median value). This is particularly important as we try to understand the impact of different changes to a system over time.

With a small amount of data, the median (and thus the above rules) may not be useful. The shift and run rules require more than 10 points before they are applicable.

Table 1Checking for too many or too few runs on a runchart. Table is based on about a 5% risk of falling the runtest for random patterns of data

10 3 9 11 3 10 12 3 11 13 4 11 14 4 12 15 5 12 16 5 13 17 5 13 18 6 14 19 6 15 20 6 16 21 7 17 23 7 17 23 7 17 24 8 18 26 9 19 27 10 19 28 10 20 30 11 21 31 11 22 32 11 23 33 12 23 34 12 24 36 13 25 37 13 25 38 14 26 39 14 26 39 14 26 39 14 26 39 14 26 39 14 26 39 14 26 39 14 26 39 14 26 39 14 26 39 14 26 39 14 26 39 14 26 39 14 26 39 14 26 39 14 26 39 14 26 44 17 31	Total number of data points on the run chart that do not fall on the median	Lower limit for the number of runs (< than this number runs is 'too few')	Upper limit for the number of runs (> than this number runs is 'too many')
12 3 11 13 4 11 14 4 12 15 5 12 16 5 13 17 5 13 18 6 14 19 6 15 20 6 16 21 7 17 23 7 17 24 8 18 26 9 19 27 10 19 28 10 20 29 10 20 30 11 21 31 11 22 32 11 23 33 12 23 34 12 24 36 13 25 38 14 26 40 15 27 41 15 27 41 15 27 41 15 27 41 15 27 41 15 27 41 15 27 41 15 27 41 15 27 42 16 28 43 16 28 44 17 29 35 17 30 46 17 31 47 18 31 48 18 32 50 19 33 51 20 34 53 21 34 54 21	10	3	9
13411144121551216513175131861419615206162171723717248182581826919271019281020291020301121311121331223341224351224361325381426401527411527411527421628431628441729451730461731471831481832491932501933512033522034532134542135552235562235572336582337	11		10
14 4 12 15 5 12 16 5 13 17 5 13 18 6 14 19 6 15 20 6 16 21 7 17 23 7 17 24 8 18 26 9 19 27 10 19 28 10 20 29 10 20 29 10 20 30 11 21 31 11 22 32 11 23 33 12 23 34 12 24 36 13 25 38 14 26 40 15 27 41 15 27 41 15 27 41 15 27 41 15 27 41 15 27 41 15 27 41 15 27 41 15 27 41 15 27 41 15 27 42 16 28 43 16 28 44 17 30 46 17 31 47 18 31 48 18 32 55 22 25 56 22 35 55 22 35 55 22 <t< td=""><td></td><td>3</td><td>11</td></t<>		3	11
15 5 12 16 5 13 17 5 13 18 6 14 19 6 15 20 6 16 21 7 17 23 7 17 24 8 18 26 9 19 27 10 19 28 10 20 29 10 20 30 11 21 31 11 22 32 11 23 33 12 23 34 12 24 36 13 25 38 14 26 39 14 26 40 15 27 41 15 27 41 15 27 44 17 29 45 17 30 46 17 31 48 18 32 49 19 32 50 19 33 51 20 33 52 20 34 53 21 34 54 21 35 55 22 35 56 22 35 56 22 35 57 23 36			11
16 5 13 17 5 13 18 6 14 19 6 15 20 6 16 21 7 17 23 7 17 23 7 17 24 8 18 25 8 18 26 9 19 27 10 19 28 10 20 29 10 20 29 10 20 30 11 21 31 11 22 32 11 23 33 12 23 34 12 24 35 12 24 36 13 25 38 14 26 39 14 26 40 15 27 41 15 27 41 15 27 42 16 28 43 16 28 44 17 29 45 17 30 46 17 31 47 18 31 48 18 32 49 19 32 50 19 33 51 20 33 52 20 34 53 21 34 54 21 35 55 22 35 56 22 35 57 23 <t< td=""><td></td><td></td><td></td></t<>			
17513 18 614 19 615 20 616 21 716 22 717 23 717 24 818 25 818 26 919 27 1019 28 1020 29 1020 30 1121 31 1122 32 1123 33 1223 34 1224 35 1224 36 1325 37 1325 38 1426 40 1527 41 1527 42 1628 43 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 56 2235 56 2336 58 2337			
18614 19 615 20 616 21 716 22 717 23 717 24 818 25 818 26 919 27 1019 28 1020 29 1020 30 1121 31 1122 32 1123 33 1223 34 1224 35 1224 36 1325 37 1325 38 1426 40 1527 41 1527 41 1527 42 1628 43 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 56 2235 56 2336 58 2337			
1961520616217162271723717248182581826919271019281020291020301121311122321123331223341224351224361325371325381426401527411527421628431628441729451730461731471831481832491932501933512033522034532134542135552235562235572336582337			
20616 21 716 22 717 23 717 24 818 25 818 26 919 27 1019 28 1020 29 1020 30 1121 31 1122 32 1123 33 1223 34 1224 35 1224 36 1325 37 1325 38 1426 40 1527 41 1527 41 1527 42 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 57 2336 58 2337			
21716 22 717 23 717 24 818 25 818 26 919 27 1019 28 1020 29 1020 30 1121 31 1122 32 1123 33 1223 34 1224 35 1224 36 1325 37 1325 38 1426 40 1527 41 1527 42 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 56 2235 57 2336 58 2337			
22717 23 717 24 818 25 818 26 919 27 1019 28 1020 29 1020 30 1121 31 1122 32 1123 33 1223 34 1224 35 1224 36 1325 38 1426 40 1527 41 1527 41 1527 41 1527 42 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 56 2235 57 2336 58 2337			
23717 24 818 25 818 26 919 27 1019 28 1020 29 1020 30 1121 31 1122 32 1123 33 1223 34 1224 35 1224 36 1325 37 1325 38 1426 40 1527 41 1527 41 1527 41 1527 42 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 56 2235 57 2336 58 2337			
24818 25 818 26 919 27 1019 28 1020 29 1020 30 1121 31 1122 32 1123 33 1223 34 1224 35 1224 36 1325 37 1325 38 1426 40 1527 41 1527 41 1527 42 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 57 2336 58 2337			
25818 26 919 27 1019 28 1020 29 1020 30 1121 31 1122 32 1123 33 1223 34 1224 35 1224 36 1325 37 1325 38 1426 40 1527 41 1527 41 1527 42 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 57 2336 58 2337			
26919 27 1019 28 1020 29 1020 30 1121 31 1122 32 1123 33 1223 34 1224 35 1224 36 1325 37 1325 38 1426 40 1527 41 1527 41 1527 42 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 57 2336 58 2337			
271019 28 1020 29 1020 30 1121 31 1122 32 1123 33 1223 34 1224 35 1224 36 1325 37 1325 38 1426 40 1527 41 1527 42 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 57 2336 58 2337			
281020 29 1020 30 1121 31 1122 32 1123 33 1223 34 1224 35 1224 36 1325 37 1325 38 1426 40 1527 41 1527 42 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 57 2336 58 2337			
3011 21 31 11 22 32 11 23 33 12 23 34 12 24 35 12 24 36 13 25 37 13 25 38 14 26 40 15 27 41 15 27 41 16 28 43 16 28 44 17 29 45 17 30 46 17 31 47 18 31 48 18 32 49 19 32 50 19 33 51 20 34 53 21 34 54 21 35 55 22 35 56 22 35 57 23 36 58 23 37			20
31 11 22 32 11 23 33 12 23 34 12 24 35 12 24 36 13 25 37 13 25 38 14 26 40 15 27 41 15 27 41 15 27 42 16 28 43 16 28 44 17 29 45 17 30 46 17 31 47 18 31 48 18 32 50 19 33 51 20 33 52 20 34 53 21 34 54 21 35 55 22 35 56 22 35 57 23 36 58 23 37	29	10	20
3211 23 33 12 23 34 12 24 35 12 24 36 13 25 37 13 25 38 14 26 40 15 27 41 15 27 41 15 27 42 16 28 43 16 28 44 17 29 45 17 30 46 17 31 47 18 31 48 18 32 50 19 33 51 20 33 52 20 34 53 21 34 54 21 35 55 22 35 56 22 35 57 23 36 58 23 37	30		21
331223 34 1224 35 1224 36 1325 37 1325 38 1426 39 1426 40 1527 41 1527 42 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2034 53 2134 54 2135 55 2235 56 2235 57 2336 58 2337			
341224 35 1224 36 1325 37 1325 38 1426 39 1426 40 1527 41 1527 42 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 57 2336 58 2337			
35 12 24 36 13 25 37 13 25 38 14 26 39 14 26 40 15 27 41 15 27 42 16 28 43 16 28 44 17 29 45 17 30 46 17 31 47 18 31 48 18 32 50 19 33 51 20 33 52 20 34 53 21 34 54 21 35 55 22 35 56 22 35 57 23 36 58 23 37			
36 13 25 37 13 25 38 14 26 39 14 26 40 15 27 41 15 27 42 16 28 43 16 28 44 17 29 45 17 30 46 17 31 47 18 31 48 18 32 50 19 33 51 20 33 52 20 34 53 21 34 54 21 35 55 22 35 56 22 35 57 23 36 58 23 37			
37 13 25 38 14 26 39 14 26 40 15 27 41 15 27 42 16 28 43 16 28 44 17 29 45 17 30 46 17 31 47 18 31 48 18 32 50 19 33 51 20 33 52 20 34 53 21 34 54 21 35 55 22 35 56 22 35 57 23 36 58 23 37			
381426 39 1426 40 1527 41 1527 42 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 57 2336 58 2337			
391426 40 1527 41 1527 42 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 57 2336 58 2337			
401527 41 1527 42 1628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 57 2336 58 2337			
41 15 27 42 16 28 43 16 28 44 17 29 45 17 30 46 17 31 47 18 31 48 18 32 49 19 32 50 19 33 51 20 33 52 20 34 53 21 34 54 21 35 55 22 35 56 22 35 57 23 36 58 23 37			
421628 43 1628 44 1729 45 1730 46 1731 47 1831 48 1832 49 1932 50 1933 51 2033 52 2034 53 2134 54 2135 55 2235 56 2235 57 2336 58 2337			
$\begin{array}{cccccccccccccccccccccccccccccccccccc$			
441729451730461731471831481832491932501933512033522034532134542135552235562235572336582337			
451730461731471831481832491932501933512033522034532134542135552235562235572336582337			29
471831481832491932501933512033522034532134542135552235562235572336582337			30
481832491932501933512033522034532134542135552235562235572336582337			
491932501933512033522034532134542135552235562235572336582337			
501933512033522034532134542135552235562235572336582337			
512033522034532134542135552235562235572336582337			
522034532134542135552235562235572336582337			
532134542135552235562235572336582337			
542135552235562235572336582337			
55 22 35 56 22 35 57 23 36 58 23 37			
56 22 35 57 23 36 58 23 37			
57 23 36 58 23 37			
58 23 37			
59 24 38			
60 24 38			

Source: Adapted from Swed and Eisenhart.¹²


But the user should decide when to calculate the median when starting the run chart. There are many applications (eg, patient monitoring of annual PSA tests) where the run chart is useful with just three or four data points in order to get an early indication of central tendency and trend. In the case of PSA testing, we usually do not have the luxury of many data points but still need to learn from the data to help form a clinical decision.


LIMITATIONS

As with any analytical tool, there are limitations to run charts. First, run charts are designed for the early detection of signals of improvement or degradation in a process over time. However, run charts are not capable of determining if a process is stable (as defined by Shewhart in relation to control charts only). Using control chart language with run charts can create confusion because the two methods include different rules for identifying non-random patterns. Shewhart charts identify deviations from the centreline (mean, not the median) using control limits. Figure 4 shows a run chart with no signals of non-random variation. Some might be tempted to declare this process stable. These same data when displayed on the appropriate Shewhart chart, however, reveal special causes. This process is not stable. Determining if a process is stable is important to understand if improvements have been sustained and to predict future performance which will impact decisionmaking. To determine if a process or system is in a stable state, a Shewhart (control) chart is needed.^{4 5 13} In using run charts, we recommend avoiding the terms special and common cause and stable or unstable, reserving their use for Shewhart (control) charts.

Second, there are situations in healthcare settings where the data are discrete and can make use of the run chart rules more complex. For example, if 50% or more of the data on a run chart represents the absolute extreme values on the scale (eg, 0 or 100% on a percentage scale), the criteria for detecting a nonrandom statistical signal using the median cannot be applied. In these cases, the data will not yield a useful median making application on the rules useless. The median will be the extreme absolute value itself (0% or 100%). In these cases, one could use the mean as the centerline (if no extreme data values were observed). Another option in this case would be to display the time (eg, days) or workload (eg, number of cases) between the event on the run chart, plotting each time an event occurs.^{4 5} More time or workload between undesirable events may be a sign of improvement. Although beyond the scope of this paper, strategies to modify run charts to address these types of unusual data situations are available.4 6

ORIGINAL RESEARCH

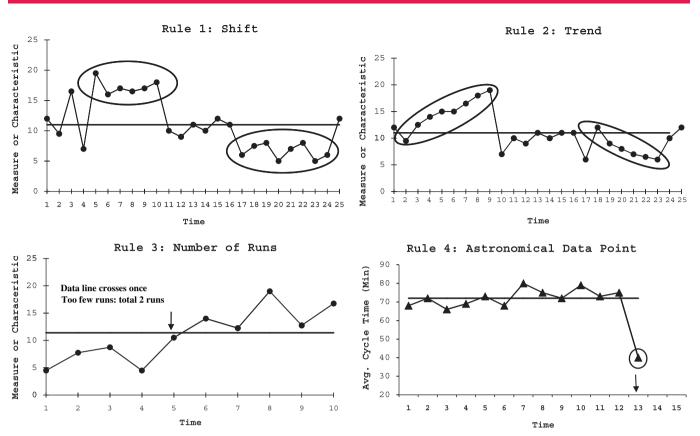



25

1

2 3


5

6 7 8

4

9

10 11 12



Run Chart (n=500) 55 Unreconciled Medications 50 45 40 35 30 o/0 25 15 16 17 18 19 20 21 22 23 24 25 1 2 7 11 12 13 14 3 4 5 6 8 9 10 Shewhart Chart (n=500) 55 Unreconciled Medications 50 UL 48.5 45 Mean 41.9 40 35 30 0/٥

13 14 15 16 17 18

19 20 21 22 23 24 25

Third, as was shown in the example in figure 2, run charts require judgement and understanding of the context and situation in which the data are collected and presented because it is ultimately the context of a situation that drives our predictions and goals. Lastly, healthcare providers and professionals are largely trained in aggregate summary statistics and hypothesis testing paradigms which focus often on larger amounts of data at distant intervals. Using run charts, and other statistical process control tools, requires more regular monitoring and data collection for the purposes of better understanding the voice of the process (and sometimes the voice of the patient). Those leading improvement efforts using such tools should recognise the potential for more frequent data collection over shorter time periods (see box online).

CONCLUSION

Run charts are easy to construct and simple to interpret. Since improvements are made over time, plotting data over time using a run chart is a fundamental method to evaluate the success of improvement efforts in an objective way. The run chart is therefore an important tool with wide potential application in healthcare improvement. Some healthcare organizations use run charts as part of their process improvement efforts presently, but far more do not. Without some objective and simple measure of change and improvement we are left with speculation, intuition, subjective assessments or the application of inappropriate statistical approaches. There is growing recognition that quality measurement tools, such as run charts, are important for research and planned experimentation that informs how we think about and understand the systems and outcomes we want to improve.⁶ It has long been advocated that

aggregate summary statistics always include measures of data in their natural time order as a means of acquiring knowledge. $^{13\ 14}$

The value of a run chart is its simplicity and versatility in letting us learn from our data. By adding some probability-based rules to aid interpretation, we get a picture of the process over time and a method to systematically identify non-random signals. The information provided in this paper provides the necessary information to begin exploring and using run charts as an analytical tool for improvement projects in healthcare.

Competing interests None.

Provenance and peer review Not commissioned; externally peer reviewed.

REFERENCES

- 1. Ott E. *Process Quality Control.* New York: McGraw-Hill Book Company, 1975:34–44.
- Neuhauser D, Diaz M. Quality improvement research: are randomised trials necessary? Qual Saf Health Care 2007;16:77–80.
- Thor J, Lundberg J, Ask J, *et al.* Application of statistical process control in healthcare improvement: systematic review. *Qual Saf Health Care* 2007;16:387–99.
- 4. Provost L, Murray S. *The Healthcare Data Guide: Learning from Data for Improvement*. San Francisco: Jossey-Bass, Publication, 2011.
- 5. Benneyan JC, Lloyd RC, Plsek PE. Statistical process control as a tool for research and healthcare improvement. *Qual Saf Health Care* 2003;12:458–64.
- 6. Moen RD, Nolan TW, Provost LP. *Quality Improvement Through Planned Experimentation*. McGraw-Hill, 1999.
- Speroff T, O'Connor G. Study designs for PDSA quality improvement research. Qual Manag Health Care 2004;13:17–32.
- 8. Deming WE. The New Economics: For Industry, Government, Education. Cambridge, MA: MIT Press, 1994.
- Langley GJ, Moen RD, Nolan KM, et al. The Improvement Guide: A Practical Approach To Enhancing Organizational Performance. San Francisco, CA: Jossey-Bass, 2009.
- 10. Lloyd RC. *Quality Health Care: A Guide To Developing And Using Indicators*. Boston, MA: Jones and Bartlett, 2004.
- 11. Olmstead Pl. Distribution of sample arrangements for runs up and down. *Ann Math Stat* 1945;17:24–33.
- 12. Swed FS, Eisenhart C. Tables for testing randomness of grouping in a sequence of alternatives. *Ann Math Stat* 1943;14:66–87.
- Shewhart WA. The Economic Control Of Quality Of Manufactured Product, New York: D Van Nostrand, 1931.
- 14. Deming WE. On probability as a basis for action. *Am Stat* 1975;29:146–52.